
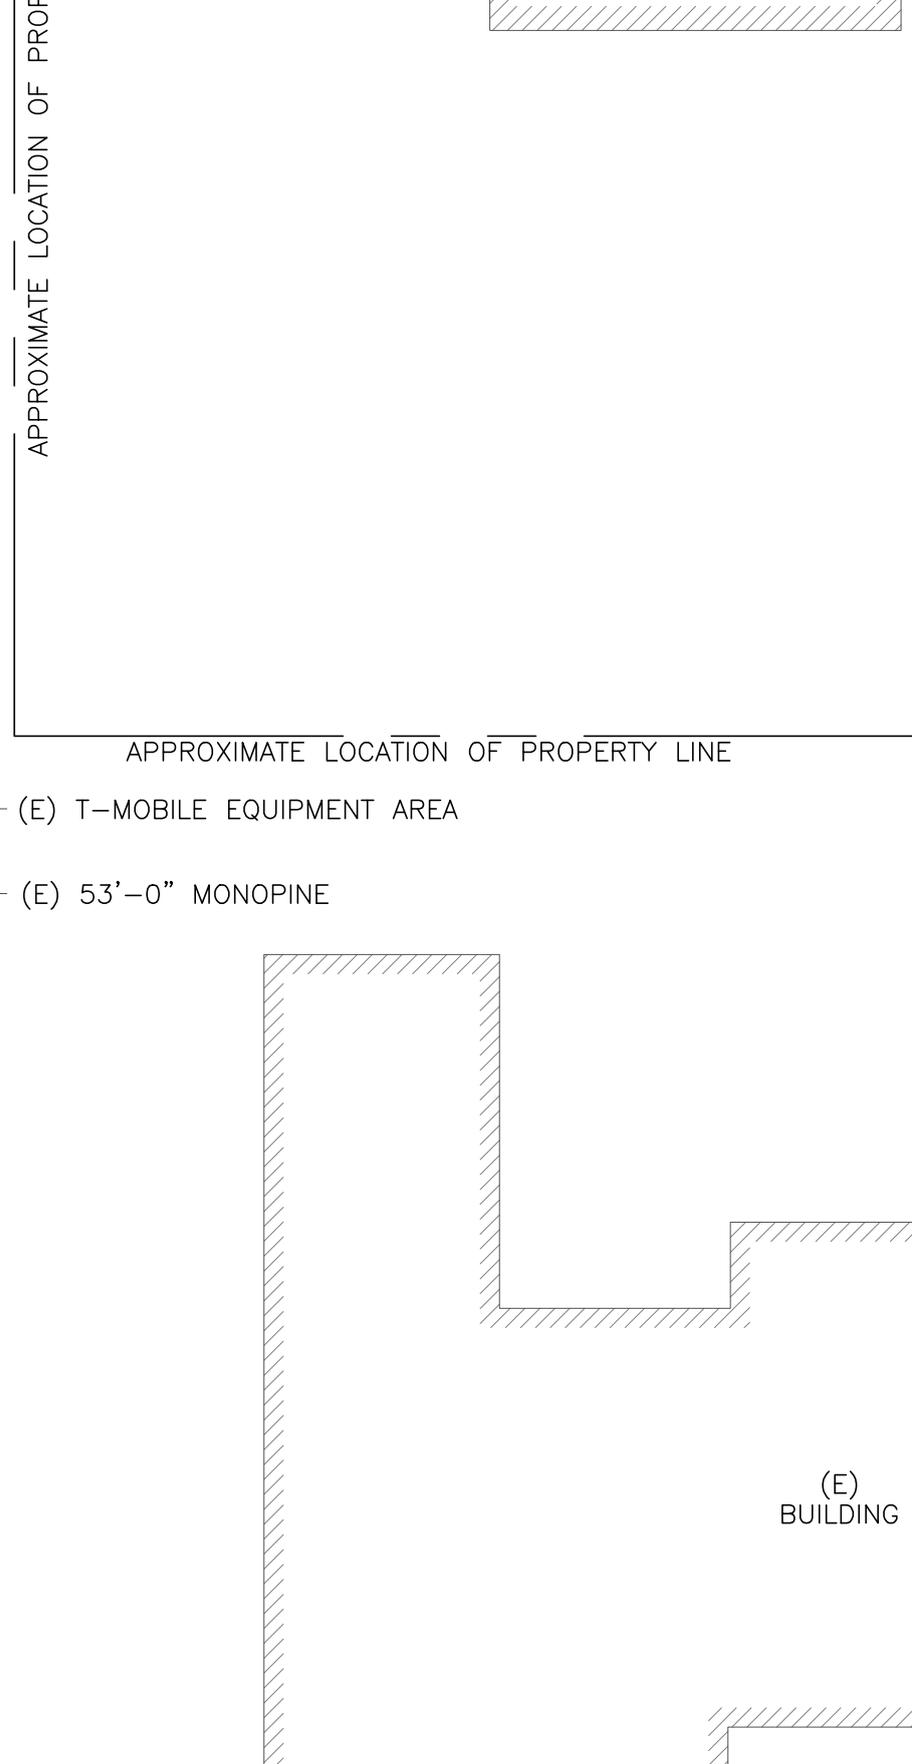


APPROXIMATE LOCATION

HALLADAY ST

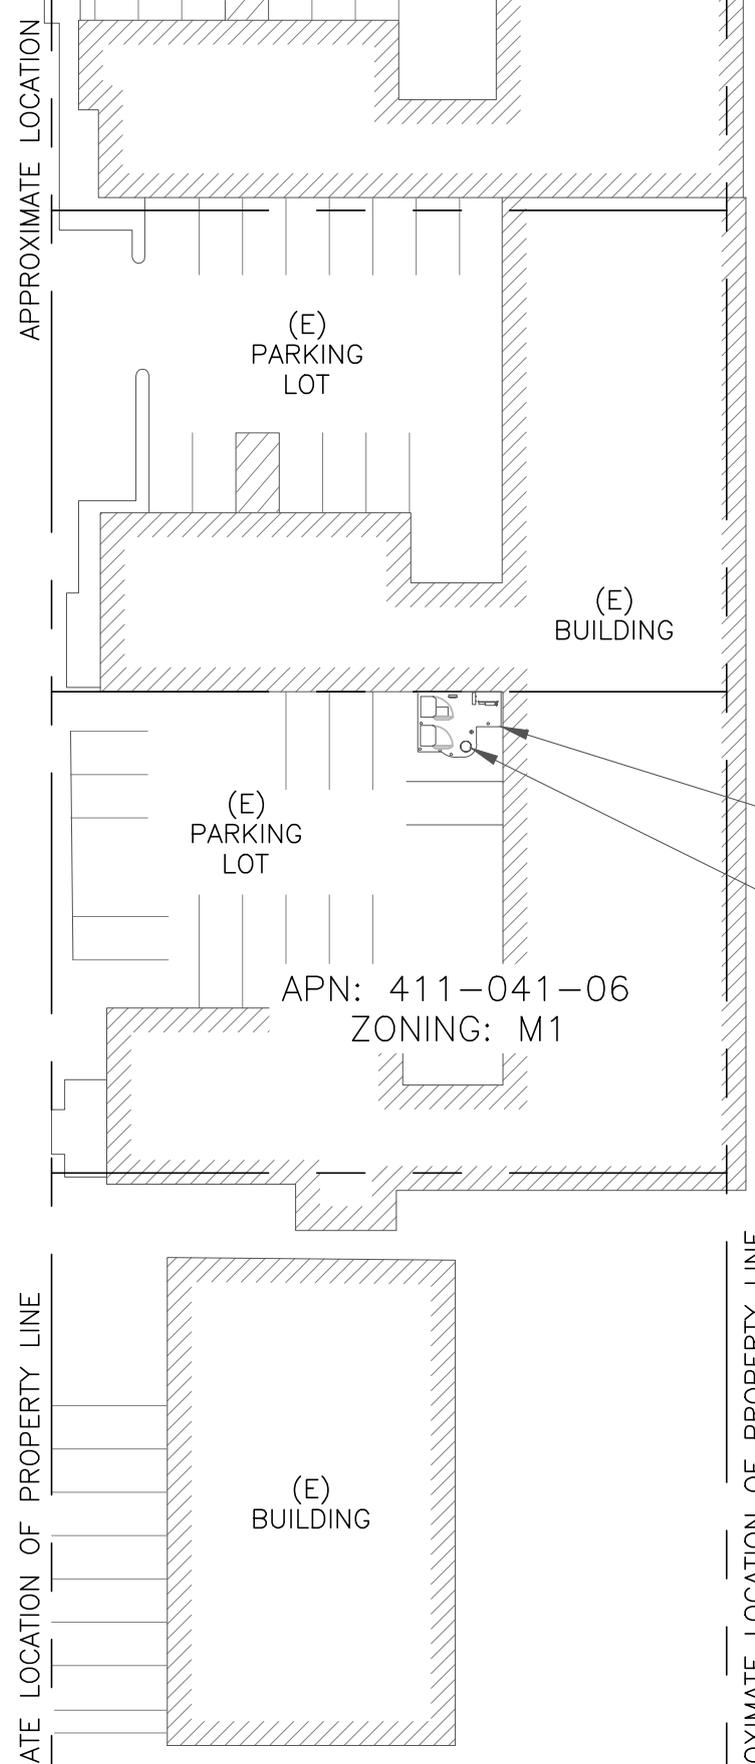

T-MOBILE SITE NUMBER:
LA64151A

BU #: 823179
CLAYTON - HALLADAY ST

2929 HALLADAY ST
SANTA ANA, CA 92705

EXISTING 53'-0" MONOPINE

ISSUED FOR:


REV	DATE	DRWN	DESCRIPTION	DES./QA
A	03/01/19	CM	PRELIMINARY	LMR
0	07/29/20	AK	SUBMITTAL	CW
1	08/21/20	AK	CLIENT COMMENTS	CW
2	08/27/20	AK	CLIENT COMMENTS	CW




SIGNED, 27 AUG 2020

IT IS A VIOLATION OF LAW FOR ANY PERSON,
UNLESS THEY ARE ACTING UNDER THE DIRECTION
OF A LICENSED PROFESSIONAL ENGINEER,
TO ALTER THIS DOCUMENT.

SHEET NUMBER: **C-1.2** REVISION: **2**

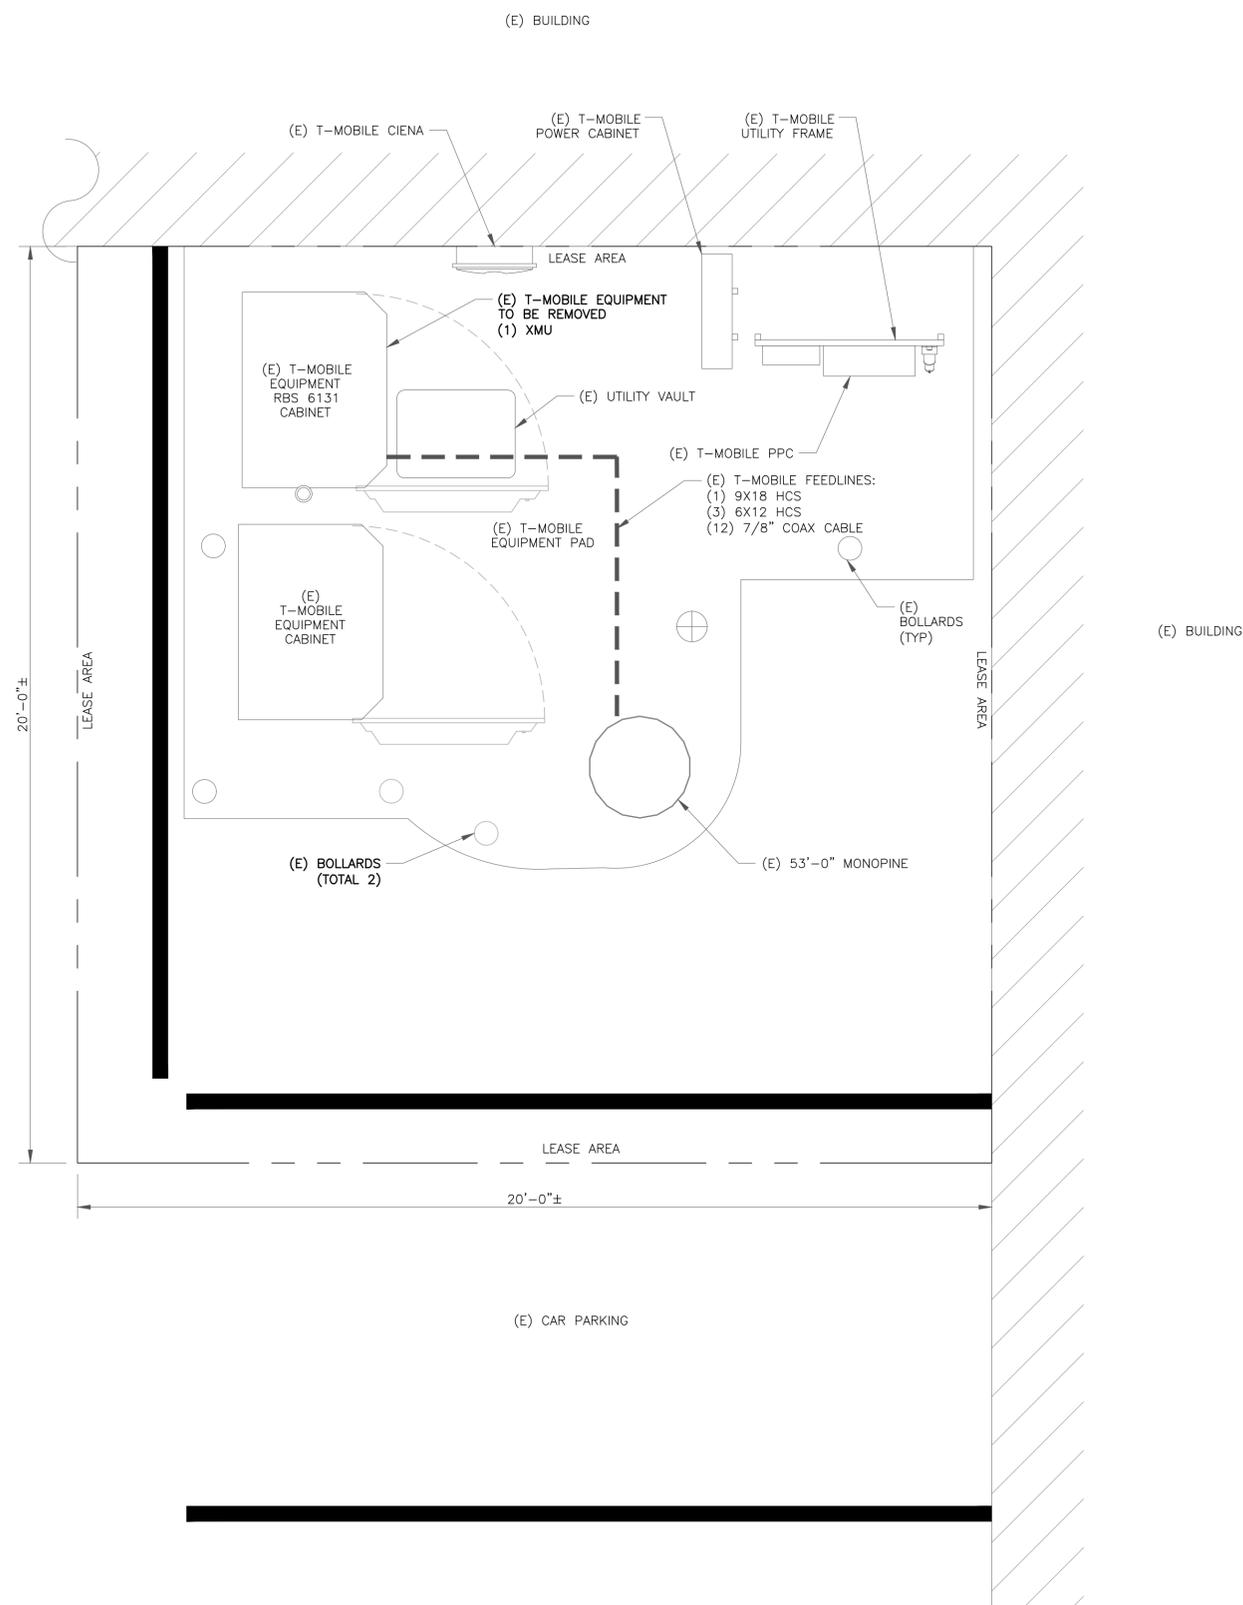


1 EXISTING EQUIPMENT PLAN
SCALE: 1/2"=1'-0" (FULL SIZE)
1/4"=1'-0" (11x17)

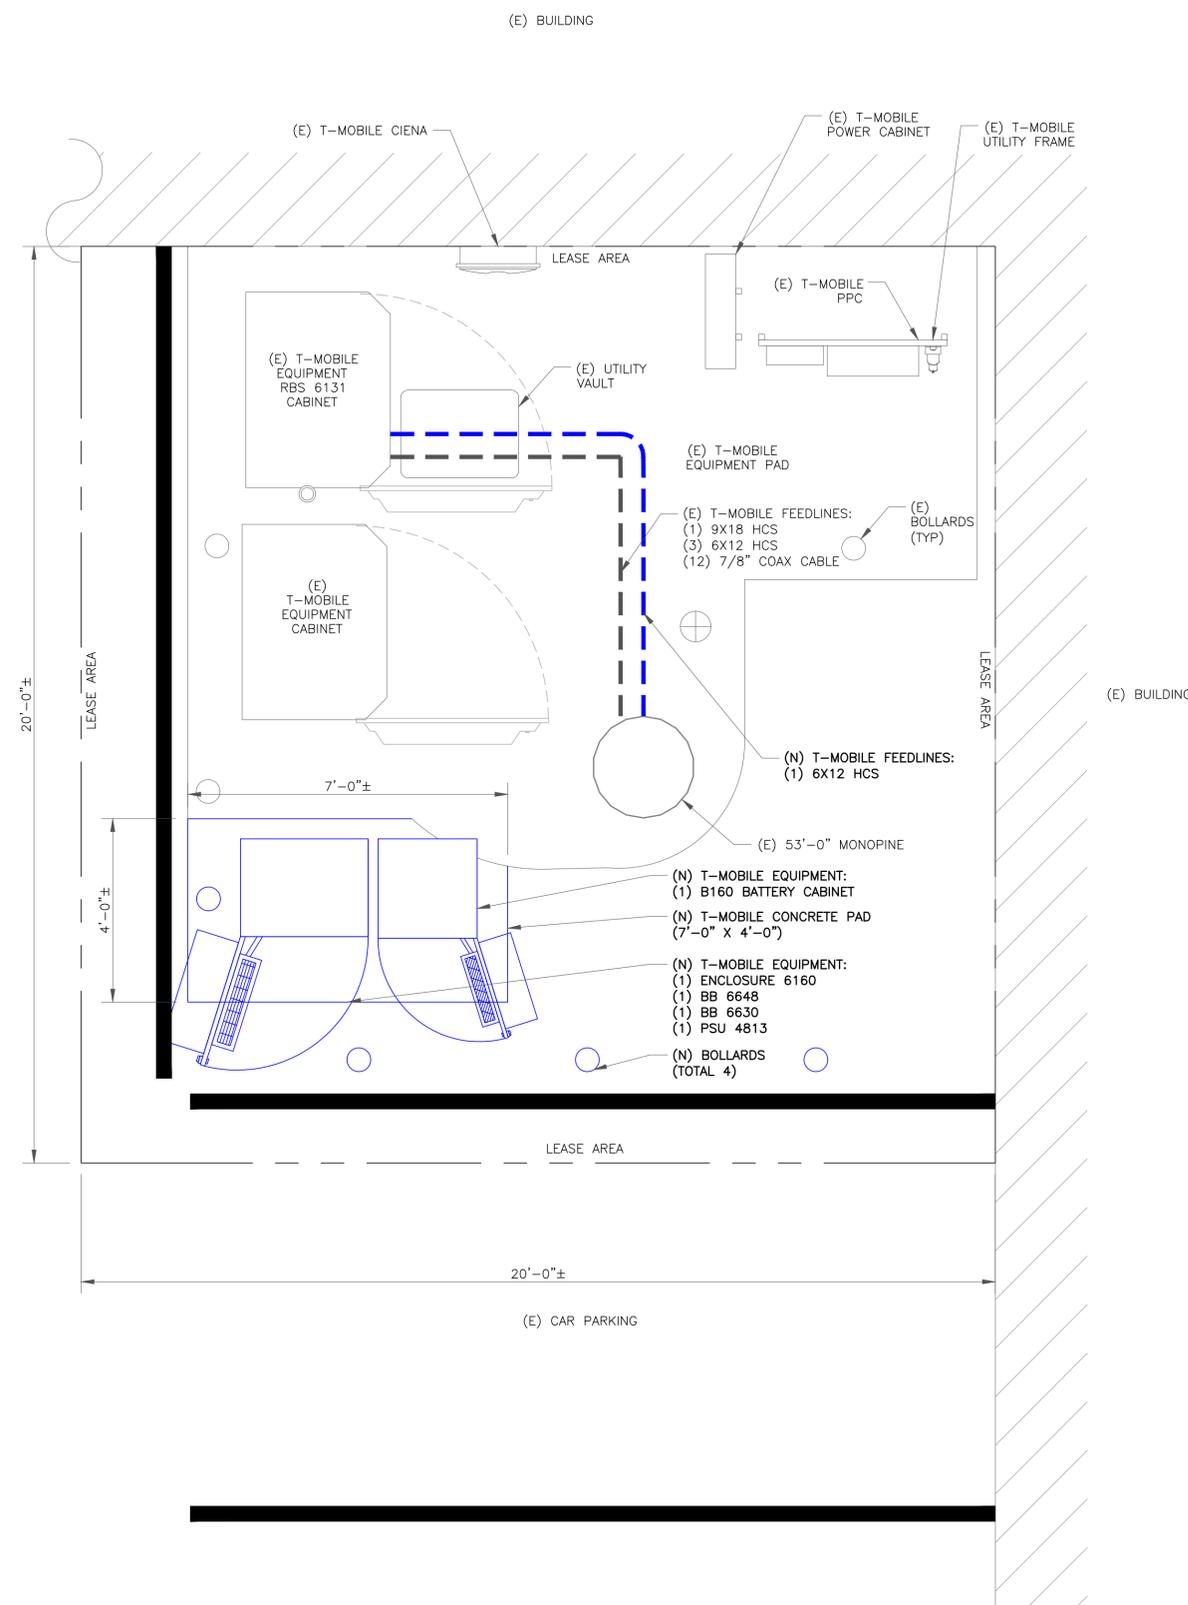


1 PROPOSED EQUIPMENT PLAN
SCALE: 1/2"=1'-0" (FULL SIZE)
1/4"=1'-0" (11x17)



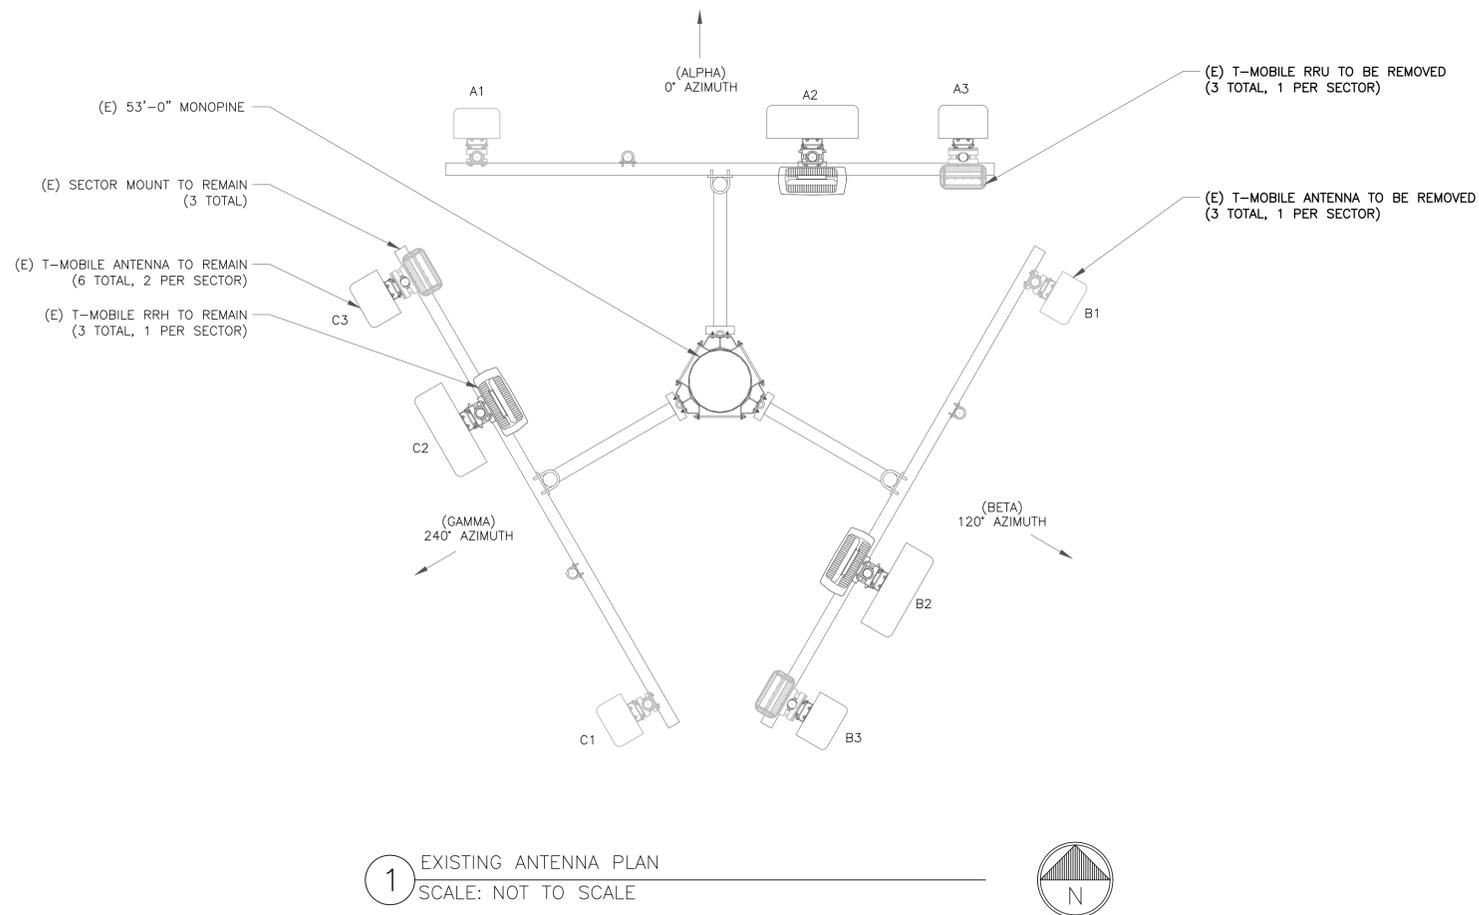

1 EXISTING ANTENNA PLAN
SCALE: NOT TO SCALE

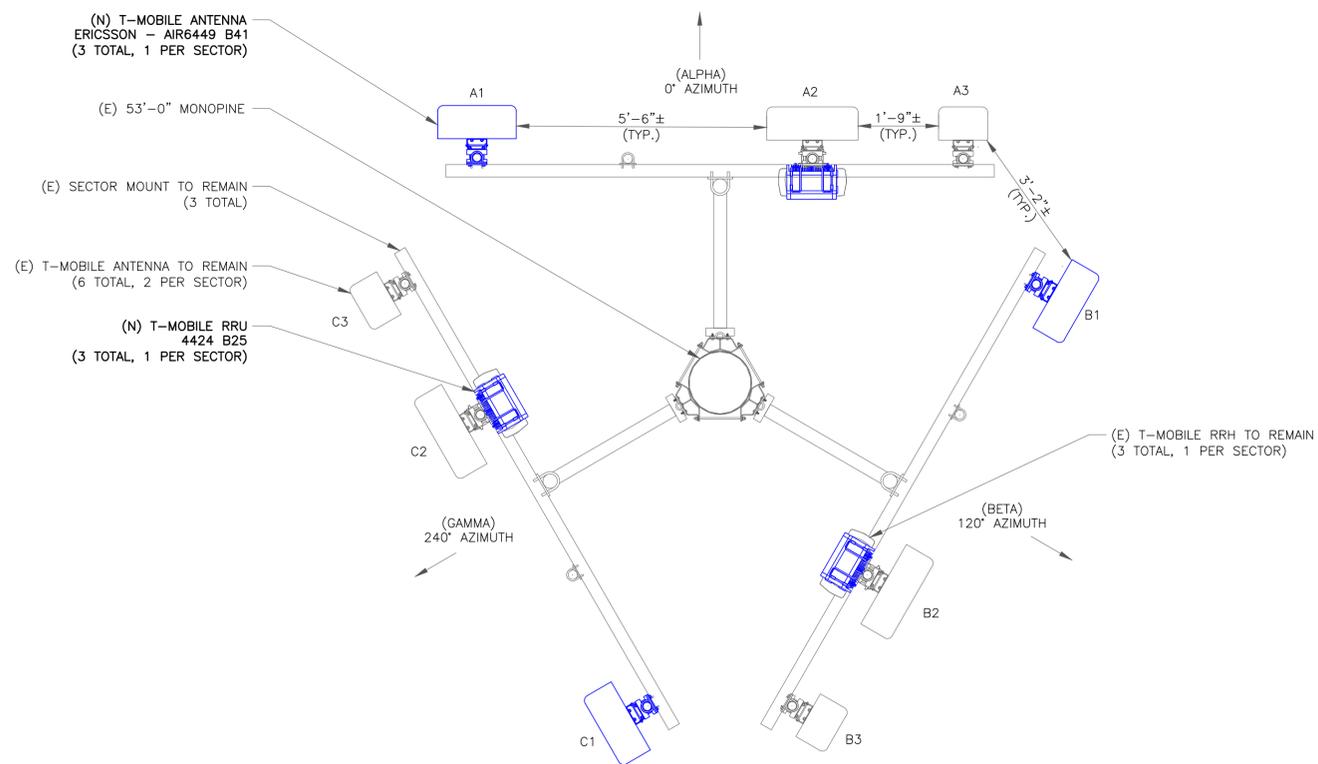

2 NEW ANTENNA PLAN
SCALE: NOT TO SCALE

"LOOK UP" - CROWN CASTLE USA INC. SAFETY CLIMB REQUIREMENT:

THE INTEGRITY OF THE SAFETY CLIMB AND ALL COMPONENTS OF THE CLIMBING FACILITY SHALL BE CONSIDERED DURING ALL STAGES OF DESIGN, INSTALLATION, AND INSPECTION. TOWER MODIFICATION, MOUNT REINFORCEMENTS, AND/OR EQUIPMENT INSTALLATIONS SHALL NOT COMPROMISE THE INTEGRITY OR FUNCTIONAL USE OF THE SAFETY CLIMB OR ANY COMPONENTS OF THE CLIMBING FACILITY ON THE STRUCTURE. THIS SHALL INCLUDE, BUT NOT BE LIMITED TO: PINCHING OF THE WIRE ROPE, BENDING OF THE WIRE ROPE FROM ITS SUPPORTS, DIRECT CONTACT OR CLOSE PROXIMITY TO THE WIRE ROPE WHICH MAY CAUSE FRICTIONAL WEAR, IMPACT TO THE ANCHORAGE POINTS IN ANY WAY, OR TO IMPEDE/BLOCK ITS INTENDED USE. ANY COMPROMISED SAFETY CLIMB, INCLUDING EXISTING CONDITIONS MUST BE TAGGED OUT AND REPORTED TO YOUR CROWN CASTLE USA INC. POC OR CALL THE NOC TO GENERATE A SAFETY CLIMB MAINTENANCE AND CONTRACTOR NOTICE TICKET.

NOTES:

1. REFERENCE C-4 FOR FINAL EQUIPMENT SCHEDULE.
2. REFERENCE C-5 FOR NEW EQUIPMENT SPECIFICATIONS.
3. CONTRACTOR TO VERIFY ALL ANTENNA TIP HEIGHTS DO NOT EXCEED BEACON BASE HEIGHT.
4. PAINT NEW EQUIPMENT TO MATCH EXISTING. INSTALL ANTENNA SOCKS

MOUNT ANALYSIS NOTES:

1. THE DESIGN DEPICTED IN THESE DRAWINGS IS VALID WHEN ACCOMPANIED BY A CORRESPONDING PASSING MOUNT ANALYSIS.
2. CONSTRUCTION MANAGER / GENERAL CONTRACTOR SHALL REVIEW THE MOUNT ANALYSIS FOR ANY CONDITIONS PRIOR TO INSTALLATION.
3. ANY REQUIRED MOUNT MODIFICATION DESIGN OR MOUNT REPLACEMENT SHALL BE APPROVED BY EOR.

T-Mobile
1755 CREEKSIDE OAKS DR. SUITE 190
SACRAMENTO, CA 95833

CROWN CASTLE
200 SPECTRUM CENTER DRIVE,
SUITE 1700 & 1800
IRVINE, CA 92618

TELCYTE
INFRASTRUCTURE SERVICES
3450 N HIGLEY RD - SUITE 102,
MESA, AZ 85215

T-MOBILE SITE NUMBER:
LA64151A

BU #: 823179
CLAYTON - HALLADAY ST

2929 HALLADAY ST
SANTA ANA, CA 92705

EXISTING 53'-0" MONOPINE

ISSUED FOR:

REV	DATE	DRWN	DESCRIPTION	DES./QA
A	03/01/19	CM	PRELIMINARY	LMR
0	07/29/20	AK	SUBMITTAL	CW
1	08/21/20	AK	CLIENT COMMENTS	CW
2	08/27/20	AK	CLIENT COMMENTS	CW

REGISTERED PROFESSIONAL ENGINEER
TIM ALEXANDER
E18344
EXP 3/31/22
SIGNED, 27 AUG 2020

IT IS A VIOLATION OF LAW FOR ANY PERSON, UNLESS THEY ARE ACTING UNDER THE DIRECTION OF A LICENSED PROFESSIONAL ENGINEER, TO ALTER THIS DOCUMENT.

SHEET NUMBER: **C-3** REVISION: **2**